


Sample Company

Location

Electrical Room #2

Switch #2

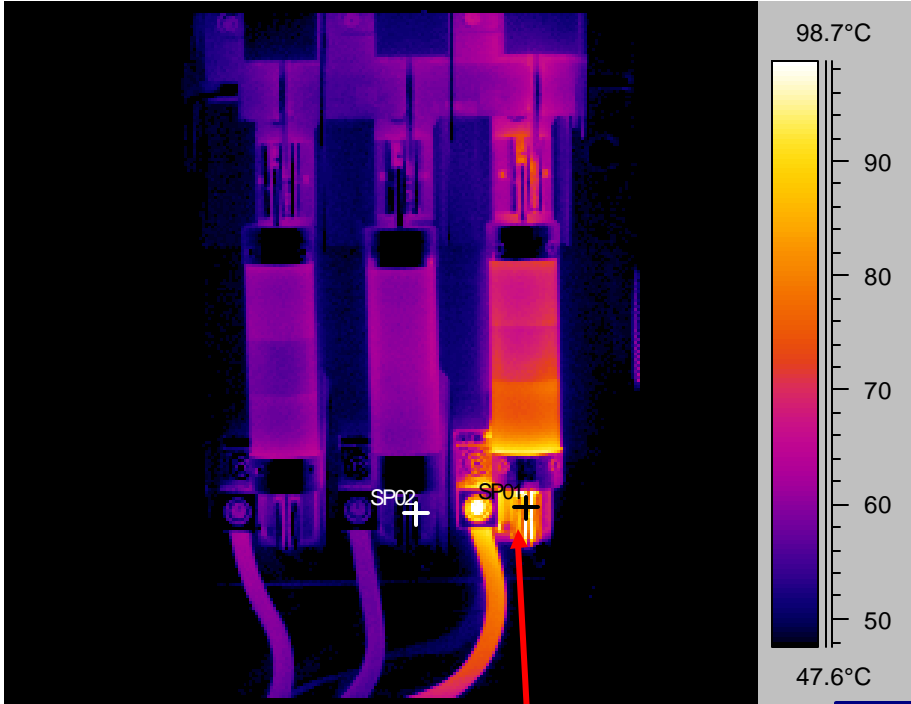

Problem #	2
Repair Priority	Critical
Hot Spot	104.3°C
Ref. Temp	47.4°C
Delta T	57.0
Time	Any Time
Date	Any Day

Evaluation

The lower C phase fuse clip and wire connection are hot. A dirty or loose connection is suspected.

Recommendations

Clean the fuse contact surfaces and fuse clip, reassemble. Check fuse clip for proper tension. Disconnect the wire. Clean the wire and lug. Inspect for signs of burning or pitting. Reassemble. Make sure the lug is properly torqued.

Repair Priority

Critical Repair Priority - Repair as soon as possible.



MIDWEST ELECTRICAL TESTING

WWW.SWGR.COM

Milwaukee Division

5141 North 35th Street
Milwaukee, WI 53209

414.931.0992 / Fax 414.461.8485

Fox Valley Division

1060 Breezewood Lane, Suite #4
Neenah, WI 54956

920.727.1600 / Fax 920.727.1620